


# XLR Cable Connector

## NC3FXCC

### Assembly Instructions

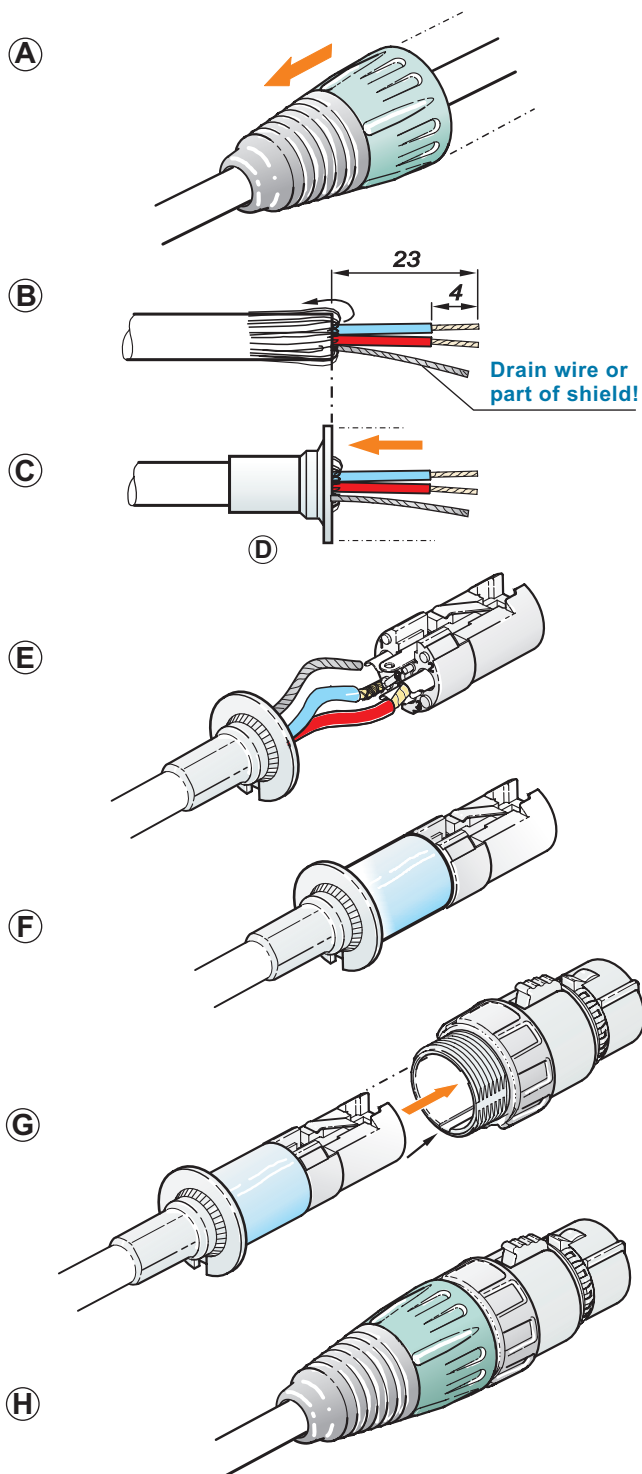

- A** Slide the boot onto the cable.
- B** Prepare cable as shown. Fold back the shield. If the cable does not offer a drain wire, twist a part of the shield for contact #1 shield wiring.
- C** Slide the crimp strain relief onto the cable jacket to the position as indicated.
- D** Crimp the strain relief by means of HEX crimp dies of width 6.5 mm (size "E" acc. to IEC 60803).
- E** Solder the wire ends to contacts #2 and #3 of insert.
- F** Position the distance sleeve between strain relief and insert.
- G** Align the nose of the crimp strain relief and the recess of the distance sleeve with respect to one of the keyways. Slide the unit into the connector housing.
- H** Finish the installation by turning the bushing onto the connector.

**NOTE:** To keep the strain relief in the keyway, avoid rotation of the cable during assembly.

**NEUTRIK AG**  
Liechtenstein

Tel.: +423/237 24 24  
Fax: +423/232 53 93  
www.neutrik.com

Draft. Nr.: BDA 94 / 3102M0851  
Update: 07.07.2003

**NEUTRIK Zürich AG**  
Switzerland

Tel.: +41 1/736 5010  
Fax: +41 1/736 5011

**NEUTRIK (UK) Ltd.**  
Great Britain

Tel.: +44 1983/811 441  
Fax: +44 1983/811 439

**NEUTRIK USA INC.**  
USA

Tel.: +1 732/901 9488  
Fax: +1 732/901 9608

**NEUTRIK Tokyo Ltd.**  
Japan

Tel.: +81 3/3663 4733  
Fax: +81 3/3663 4796

**NEUTRIK Vertriebs GmbH**  
Germany / Netherlands

Tel.: +49 8131/28 08 90  
Fax: +49 8131/28 08-30



**NEUTRIK**  
CONNECTING THE WORLD